

# Replacement Door Glass Part Number V038 TR-4/6

T-72 -C-2 August, 1972

Difficulty has been experienced with the installation of the door glass, part number V038. The reason for this is that the original glass supplied with the vehicle is 0.190" thick, whereas the replacement glass (part number V038) is 0.230" thick. The problem, however, can be overcome by simply spreading the nylon finger clamps on the upper portion of each window channel by inserting a suitable tool such as a screwdriver. It is not necessary to remove the channels from the door.

