


LEYLAND-TRIUMPH SALES COMPANY, INC.

WESTERN ZONE

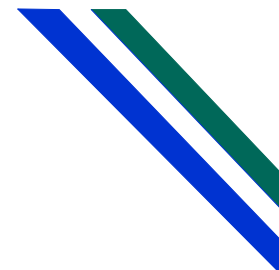

TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE DEPARTMENT

BULLETIN T-66-37

SUBJECT: TR-4A HOOD RELEASE

DATE: JULY 19, 1966

We have received reports from our field representatives indicating that difficulty is experienced in some instances with the hood becoming "jammed" in the closed position. Should you encounter such a case, you will find the adoption of the following procedure will enable relatively easy access to the hood lock:

1. Remove the 8 screws securing the glovebox and remove the glovebox.
2. Remove the rubber grommet located directly behind the glovebox where the heater control cable passes through the bulk head.
3. By maneuvering a long screwdriver or similar tool, the under side of the hood lock release mechanism can be operated.

In most cases, the approximate time involved is 30 minutes.

A modification to avoid this condition has now been introduced from CT 68700 onward.